

Coal Mines in Illinois Pana Quadrangle

Christian & Shelby Counties, Illinois

This map accompanies the Coal Mines Directory for the Pana Quadrangle. Consult the directory for a complete explanation of the information shown on this map.

- ### Mining Method
- Room & Pillar (RP)
 - Room & Pillar Basic (RPB)
 - Modified Room & Pillar (MRP)
 - Room & Pillar Panel (RPP)
 - Blind Room & Pillar (BRP)
 - Checkerboard Room & Pillar (CRP)
 - High Extraction Retreat (HER)
 - Longwall (LW)
 - Underground, Method Unknown
 - Strip Mine
 - Auger Mine
 - General Area of Mining

- ### Source of Mine Outline
- Final Mine Map
 - Not Final Mine Map
 - Undated Mine Map
 - Incomplete Mine Map
 - Secondary Source Map

- ### Tipple, Shaft, Slope, Drift Locations
- Strip Mine Tipple - Active
 - Strip Mine Tipple - Abandoned
 - Mine Shaft - Active
 - Mine Shaft - Abandoned
 - Mine Slope - Active
 - Mine Slope - Abandoned
 - Mine Drift - Active
 - Mine Drift - Abandoned
 - Air Shaft
 - Uncertain Location
 - Uncertain Type of Opening

- ### Mine Annotation
- (space permitting)
- Company
 - Mine Name
 - ISGS Index No., Years of Operation

Disclaimer

Please check the Coal Section at the Illinois State Geological Survey's web site at <http://www.isgs.illinois.edu> for the most up-to-date version of these Products.

Note that each quadrangle scale mined out area map requires the use of the associated text directory for full explanation of map features and mine attributes. Also note that some quadrangles have multiple seams of mining and therefore more than one map may be available for a particular quadrangle. Please take care to check for multiple maps as extensive mining may exist in the other seams.

The maps and digital files used for these studies were compiled from data obtained from a variety of public and private sources and have varying degrees of completeness and accuracy. They present reasonable interpretations of the geology of the area and are based on available data. Locations of some features may be offset by 500 feet or more due to errors in the original source maps, the compilation process, digitizing, or a combination of these factors. These data are not intended for use in site-specific screening or decision-making. Use of these documents does not eliminate the need for detailed studies to fully understand the geology of a specific site. The Illinois State Geological Survey, Institute of Natural Resource Sustainability, or the University of Illinois make no guarantee, expressed or implied, regarding the correctness of the interpretations presented in this data set and accept no liability for the consequences of decisions made by others on the basis of the information presented here.

These maps were designed for use at 1:24,000. Enlarging the map may reduce accuracy, as the original scale of the source maps used to compile the outlines shown varies from 1:400 to 1:150,000, and some mine locations are known only from text descriptions. See the accompanying mine directory for the original scale of the source map used for a specific mine to check accuracy of a given portion of the map. Areas with no mines shown may still be undermined; see the unmined mines list at the back of each mine directory.

The image of the U.S.G.S. Pana Quadrangle used as a base map was projected from the original UTM to Lambert Conformal Conic.



Institute of Natural Resource Sustainability
Illinois State Geological Survey
615 E. Peabody Dr.
Champaign, IL 61820

Mine Outlines Compiled by
Jennifer M. Obrad
September 8, 2008

DIRECTORY OF COAL MINES IN ILLINOIS 7.5-MINUTE QUADRANGLE SERIES PANA QUADRANGLE CHRISTIAN & SHELBY COUNTIES

Jennifer M. Obrad



Institute of Natural Resources Sustainability
ILLINOIS STATE GEOLOGICAL SURVEY
2008

**DIRECTORY OF COAL MINES IN ILLINOIS
7.5-MINUTE QUADRANGLE SERIES
PANA QUADRANGLE
CHRISTIAN & SHELBY COUNTIES**

2008

Institute of Natural Resources Sustainability
ILLINOIS STATE GEOLOGICAL SURVEY
E. Donald McKay III, Interim Director

Natural Resources Building
615 East Peabody Drive
Champaign, Illinois 61820

Phone 1-217-244-4610
Fax 1-217-333-2830

Cover photo Track-mounted duckbill loading machine at a Peabody Coal Company mine, ca. 1915.

DISCLAIMER: The accuracy and completeness of mine maps and directories vary with the availability of reliable information. Maps and other information used to compile this mine map and directory were obtained from a variety of sources and the accuracy of some of the original information cannot be verified. Consequently, the Illinois State Geological Survey (ISGS) cannot guarantee the mine maps are free of errors and disclaims any responsibility for damages that may result from actions or decisions based on them.

The ISGS updates the maps and directories periodically, and welcomes any new information or corrections. Please contact the Coal Section of the ISGS at the address shown on the title page of this directory, or telephone (217) 244-4610.

Printed by authority of the State of Illinois/2008

CONTENTS

INTRODUCTION	1
MINING IN THE PANA QUADRANGLE	1
PART I EXPLANATION OF MAP AND MINE SUMMARY SHEET	2
INTERPRETING THE MAP	2
Mine Type and Mining Method	2
SOURCE MAPS	3
POINTS AND LABELS	3
INTERPRETING A MINE SUMMARY SHEET	6
REFERENCES	8
PART II DIRECTORY OF MINES IN THE PANA QUADRANGLE	9
MINE SUMMARY SHEETS	9
Mine Index 221	
Springside Coal Company, Springside No. 3 Mine	9
Mine Index 222	
Pana Coal Company, Pana No. 2 Mine	10
Mine Index 371	
Oldroyd Coal Company, Penwell Mine	11
Mine Index 679	
Peabody Coal Company, Peabody No. 17 Mine	12
Mine Index 729	
Old Mine Coal Company, Pana No. 1 Mine	13
INDEX OF MINES IN THE PANA QUADRANGLE	14

INTRODUCTION

Coal has been mined in 76 counties of Illinois. More than 7,400 coal mines have operated since commercial mining began in Illinois about 1810; fewer than 30 are currently active. To detail the extent and location of coal mining in Illinois, the Illinois State Geological Survey (ISGS) has compiled maps and directories of known coal mines. The ISGS offers maps at a scale of 1:100,000 and accompanying directories for each county in which coal mining is known to have occurred. Maps at a scale of 1:24,000 and accompanying directories, such as this, are available for selected quadrangles. Contact the ISGS for a list of these quadrangles.

These larger scale maps show the approximate positions of mines in relation to surface features such as roads and water bodies, and indicate the mining method used and the accuracy of the mine boundaries. The maps are useful for locating mine boundaries relative to specific properties and for assessing the potential for subsidence in an area. Mine boundaries compiled from final mine surveys are generally shown within 200 feet of their true position. As a result of poor cartographic quality and inaccuracies in the original mine surveys, boundaries of some older mines may be mislocated on the map by 500 feet or more. Original mine maps should be consulted in situations that require precise delineation of mine boundaries or internal workings of mined areas.

This directory serves as a key to the accompanying mine map and provides basic information on the coal mines in the quadrangle. The directory is composed of two parts. Part I explains the symbols and patterns used on the accompanying map and the summary data presented for each mine. Part II numerically lists the mines in the quadrangle and summarizes the geology and production history of each mine. Total production for the mine, not the portion in the quadrangle, is given.

MINING IN THE PANA QUADRANGLE

The mines in this area were all located in the vicinity of the town of Pana. Mining was in the Herrin Coal seam, which is very deep in this area, at a depth of about 710 to 730 feet. Because the Herrin Coal was so deep, it was only economical for large mines to operate, given the depth of shaft that needed to be sunk. The first of the five mines to open near Pana was the Pana Coal & Mining Company (mine index 729) in 1884, which was open until 1948, one of the longest running mines. The last mine to close was the Peabody Coal Company No. 17 Mine (mine index 679), which closed in 1957.

The shale above the coal contained slips that made the roof treacherous in the mines of the Pana Quadrangle. Slabs came down without warning, and the operations often shot the roof down with the coal to avoid injuries and to make the mining process more efficient. Gas was also present in some areas, driven out of the coal by the tremendous pressure of the thick overburden.

PART I EXPLANATION OF MAP AND MINE SUMMARY SHEET

INTERPRETING THE MAP

The map accompanying this directory shows the location of coal mines known to be present in the quadrangle. The map, corresponding to a U.S. Geological Survey (USGS) 7.5-minute quadrangle, covers an area bounded by lines of latitude and longitude 7.5-minutes apart. In Illinois, a quadrangle is approximately 6.5 miles east to west and 8.5 miles north to south, an area of about 56 square miles. The USGS generally offers one map of mines per quadrangle. In some areas where extensive mining occurred in two or more overlapping seams, separate maps are compiled for mines in each seam to maintain readability of the map.

Mine Type and Mining Method

The mine type is indicated on the map by pattern color: green represents surface mines; red and yellow represent underground mines. The red patterns are used for areas of underground mining that are documented by a primary or secondary source map. A yellow pattern is used for cases where no map of the mine workings is available, but a general area of mining can be inferred from property maps or production figures. The patterns indicate the main mining methods used in underground mines. The methods are (1) room and pillar and (2) high extraction. The method used gives some indication of the amount and pattern of coal extraction within each mined area, and has some influence on the timing and type of subsidence that can occur over a mine.

The following discussion and illustrations of mining methods are based on Guither et al. (1984).

In room-and-pillar mines, coal is removed from haulage-ways (entries) and selected areas called rooms. Pillars of unmined coal are left between the rooms to support the roof. Depending on the size of rooms and pillars, the amount of coal removed from the production areas will range from 40% to 70%.

Room and Pillar - mining is divided into six categories:

- room-and-pillar basic (RPB, fig. 1A), an early method that did not follow a preset mining plan and therefore resulted in very irregular designs;
- modified room and pillar (MRP, fig. 1B);
- room-and-pillar panel (RPP, fig. 1C);
- blind room and pillar (BRP, fig. 1D);
- checkerboard room and pillar (CRP, fig. 1E);
- room and pillar (RP), a classification used when the specific type of room-and-pillar mining is unknown.

Blind and checkerboard are the most common types of room-and-pillar mining used in Illinois today. The knowledge of room-and-pillar mining methods gives a trained engineer information on the nature of subsidence that may occur. A more extensive discussion of subsidence can be found in Bauer et al. (1993).

High-extraction These mining methods are subdivided into high-extraction retreat (HER, Fig 1F) and longwall (LW, Fig 1G, 1H). In these methods, much of the coal is removed within well defined areas of the mine. Subsidence of the surface above these areas occurs within weeks. Once the subsidence activity ceases, the potential for further movement over these areas is low; however, subsidence may continue for several years after mining.

High-extraction retreat mining is a form of room-and-pillar mining that extracts most of the coal. Rooms and pillars are developed in the panels, and the pillars are then systematically removed (fig. 1F).

In early (pre-1960) longwall mines, mining advanced in multiple directions from a central shaft (fig. 1G). Large pillars of coal were left around the shaft, but all coal was removed beyond these pillars. Miners placed rock and wooden props and cribs in the mined-out areas to support the mine roof. The overlying rock gradually settled onto these supports, thus producing subsidence at the surface. In post-1959 longwall mines, room-and-pillar methods have been used to develop the main entries of the mine and panel areas. Modern longwall methods extract 100 percent of the coal in the panel areas (fig. 1H).

SOURCE MAPS

Mine outlines depicted on the map are, whenever possible, based on maps made from original mine surveys. The process of compiling and digitizing the quadrangle map may produce errors of less than 200 feet in the location of mine boundaries. Larger errors of 500 feet or more are possible for mines that have incomplete or inaccurate source maps.

Because of the extreme complexity of some mine maps, detailed features of mined areas have been omitted. The digitized mine boundary includes the exterior boundary of all rooms or entries that were at least 80 feet wide or protruded 500 feet from the main mining area. Unmined areas between mines are shown if they are at least 80 feet wide; unmined blocks of coal within mines are shown if they are at least 400 feet on each side. Original source maps should be consulted when precise information on mine boundaries or interior features is needed.

The mine summary sheet lists the source maps used to determine each mine outline. The completeness of map sources is indicated on the map by a line symbol at the mine boundary. Source maps are organized in five categories.

Final mine map The mine outline was digitized from an original map made from mine surveys conducted within a few months after production ceased. The date of the map and the last reported production are listed on the summary sheet.

Not a final map The mine is currently active or the mine outline was made from a map based on mine surveys conducted more than a few months before production ceased. This implies the actual mined-out area is probably larger than the outline on the map. The mine summary sheet indicated the dates of source maps and the last reported production, as well as the approximate tonnage mined between these two dates (if the mine is abandoned). The summary sheet also lists the approximate acreage mined since the date of the map and, in some cases, indicates the area where additional mining may have taken place. This latter information is determined by locating on the map the active faces relative to probable boundaries of the mine property.

Undated map The source map was undated, so it may or may not be based on a final mine survey. When sufficient data are available, the probable acreage of the mined area is estimated from reported production, average seam thickness and a recovery rate comparable to other mines in the area. This information is listed in the summary sheet for the mine.

Incomplete map The source map did not show the entire mine. The summary sheet indicates the missing part of the mine map and the acreage of the unmapped area, which is estimated from the amount of coal known to have been produced from the mine.

Secondary source map The original mine map was not found so the outline shown was determined from secondary sources (e.g., outlines from small-scale regional maps published in other reports). The summary sheet describes the secondary sources.

POINTS AND LABELS

The locations of all known mine openings (shafts, slopes, and drifts) and surface mine tipples are plotted on the map. Tipples are areas where coal was cleaned, stockpiled, and loaded for shipping.

Only openings or tipples are plotted for mines without source maps. If the precise locations of these features are unknown, a special symbol is used to indicate the approximate location of the mine.

Each mine on the map is labeled with the names of the mine and operating company, ISGS mine index number, and years of operation (if known) if space permits. A seam designation is given on maps where more than one seam was mined. For a mine that operated under more than one name, only the most recent name is generally given. When a mine changed names or ownership shortly before closing, an earlier name is listed. All company and mine names are listed on the mine summary sheet in the directory, under the production history segment.

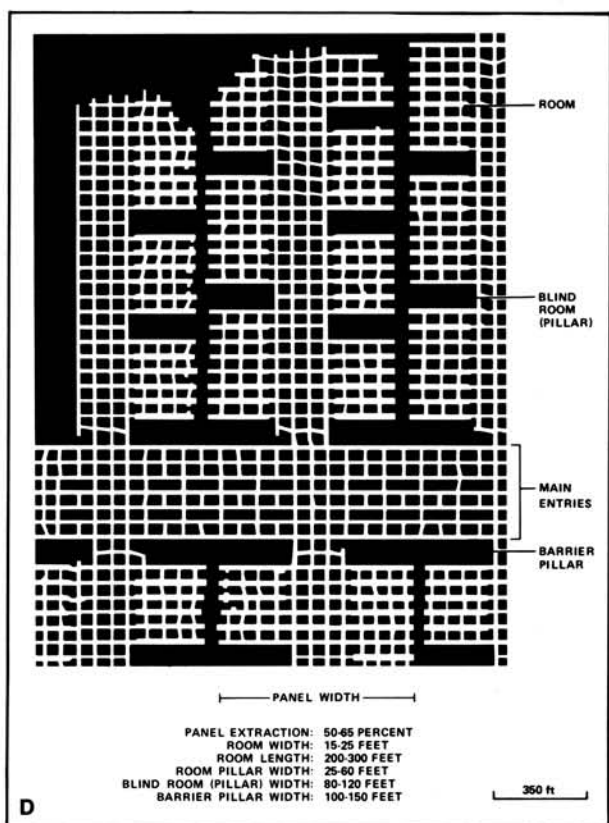
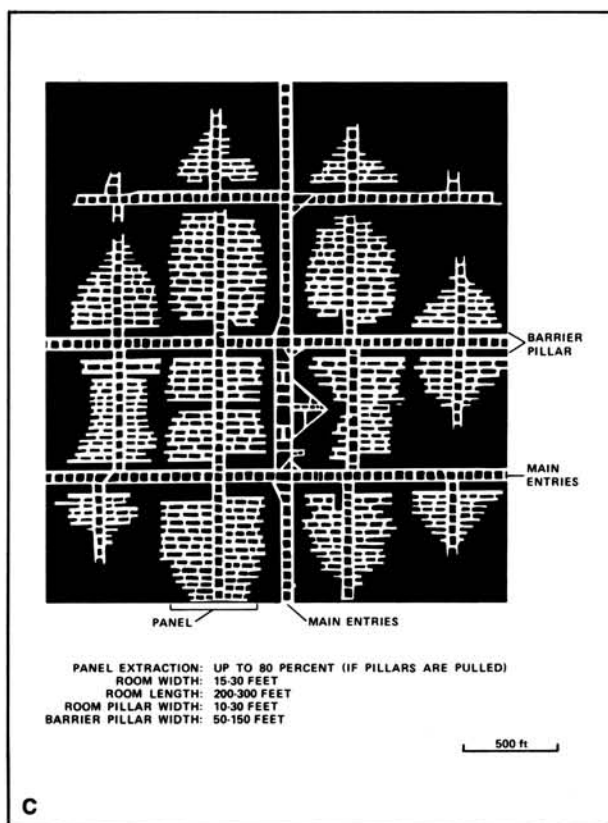
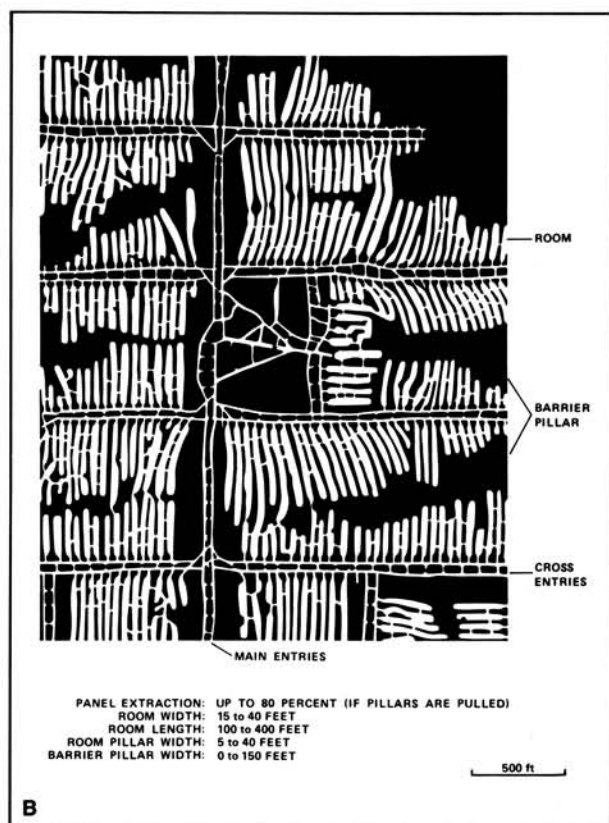
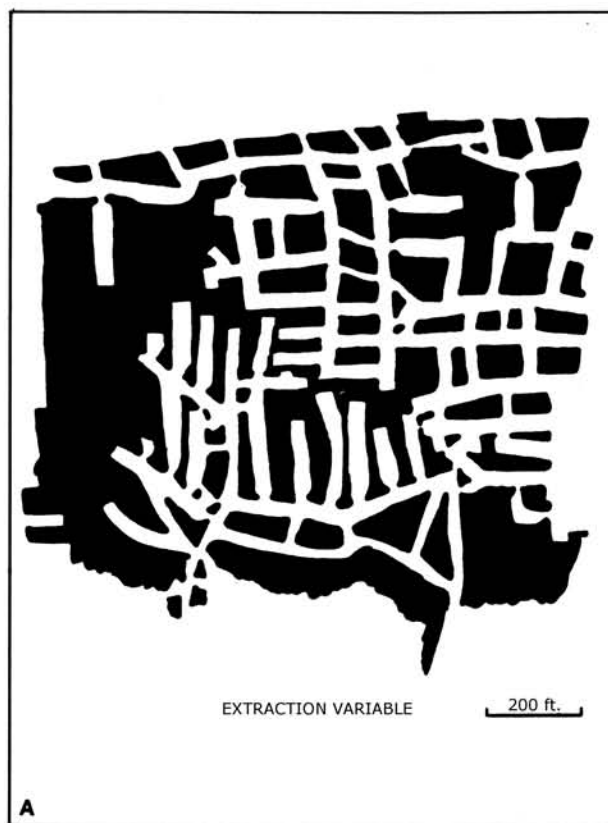


Figure 1 Mining methods: (A) room-and-pillar basic (RPB), (B) modified room and pillar (MRP), (C) room-and-pillar panel (RPP), (D) blind room and pillar (BRP).

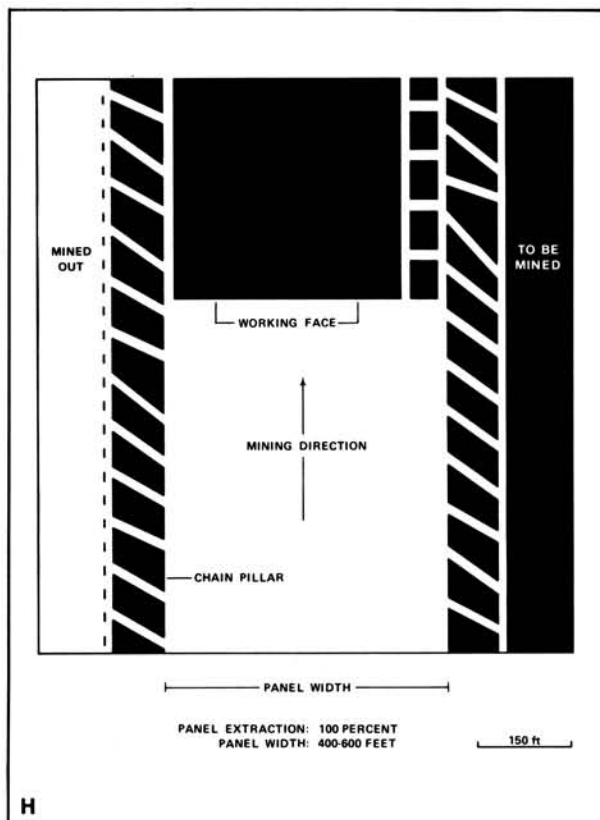
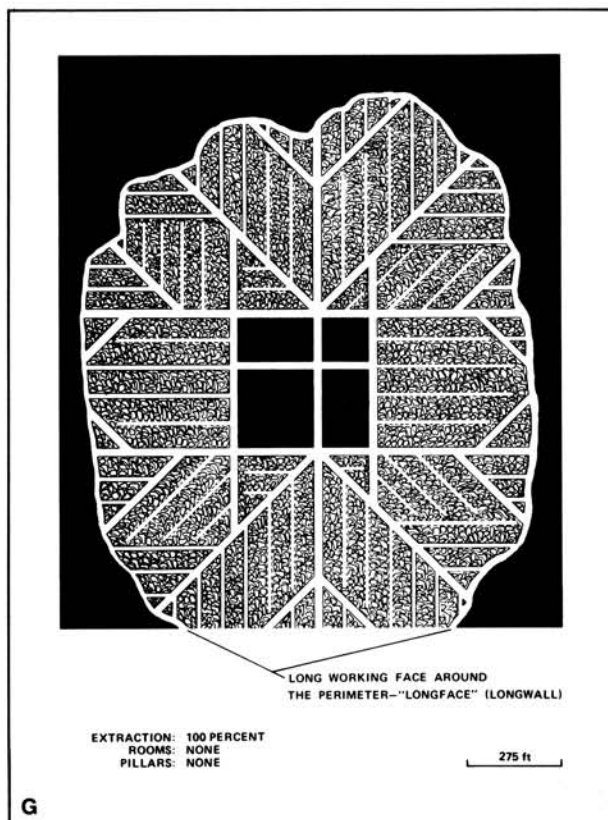
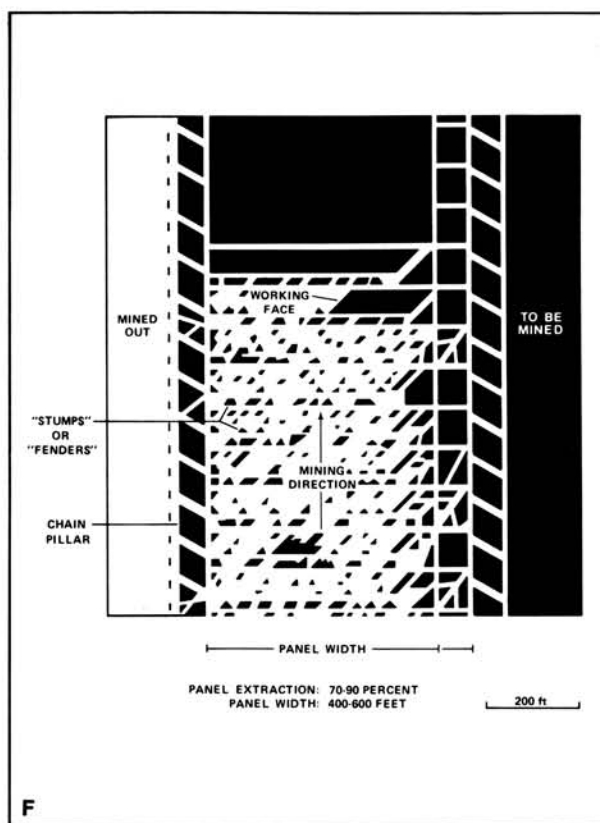
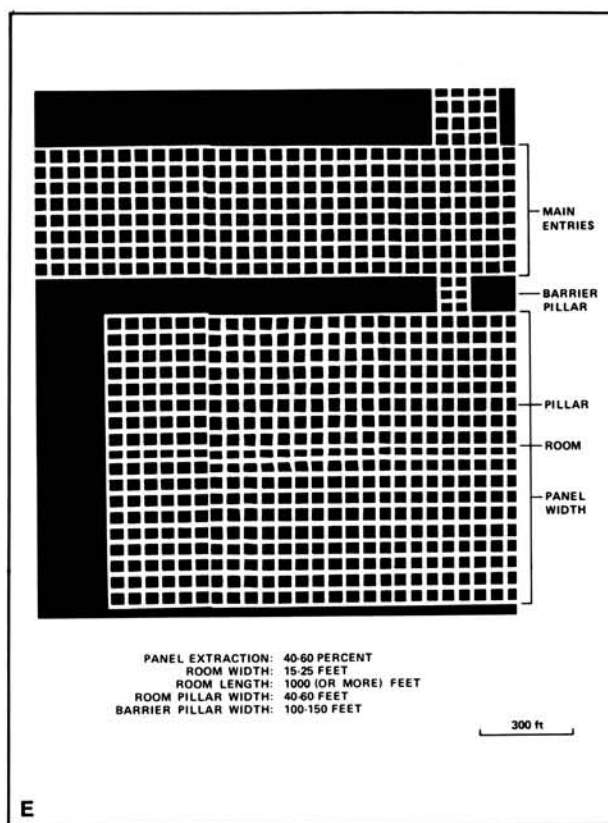


Figure 1 (cont.) Mining methods: (E) checkerboard room and pillar (CRP), (F) high extraction retreat (HER), (G) early (pre-1960) longwall, (H) post-1959 longwall

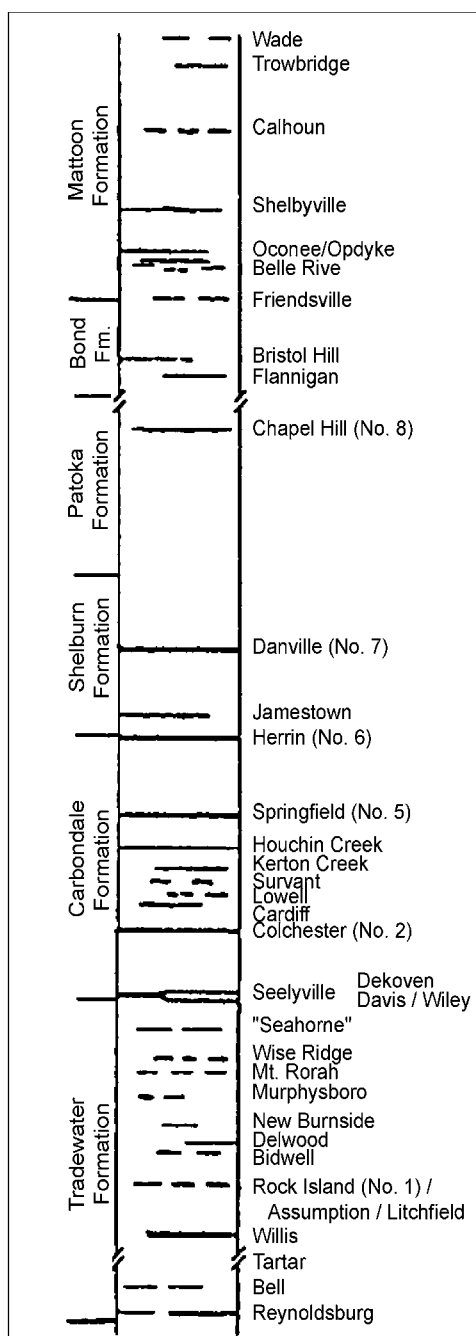


Figure 2 Generalized stratigraphic section, showing approximate vertical relations of coals in Illinois.

INTERPRETING A MINE SUMMARY SHEET

The mine summary sheet is arranged numerically by mine index number. Index numbers are shown on the map and in the mine listing. The mine summary sheet provides the following information (if available).

Company and mine name The last company or owner of the mine is used, unless no production was recorded for the last owner. In that case, the penultimate owner is listed. Mines often have no specific name; in these cases, the company name is also used as the mine name.

Type *Underground* denotes a subsurface mine in which the coal was reached through a shaft, slope, or a drift entry. *Surface* denotes a surface, open pit or strip mine.

Total mined-out acreage shown The total acreage of the mined area mapped, including any acreage mined on adjacent quadrangles, is calculated from the digitized outline of the mine. The acreage of large barrier pillars depicted on the map is excluded from the mined-out acreage. Small pillars not digitized are included in the acreage calculation. If the mine outline is not based on a final mine map, the acreage is followed by an estimate of additional acres that may have been mined. The estimate is determined from reported mine production, approximate thickness of the coal, and recovery rates calculated from nearby mines that used similar mining methods.

SHAFT, SLOPE, DRIFT OR TIPPLE LOCATIONS

Shaft, slope, drift, or tippie locations Locations of all known former entry points to underground mines or the location of coal cleaning, tippie, and shipping equipment used by the mine's facility are listed. The location is described in terms of county, township and range (Twp-Rge), section, and location within the section by quarters. NE SW NW, for instance, would describe the location in the northeast quarter of the southwest quarter of the northwest quarter. When sections are irregular in size, the quarters remain the same size and are oriented (or "registered") from the southeast corner of the section. Approximate footage from the section lines (FEL = from east line, FNL = from north line, for example) is given when that information is known; this indicates a surveyed location and is not derived from maps. Entry points are also plotted on the map and coded for the type of entry or tippie. A mine opening may have had many purposes during the life of the mine. Old hoist shafts are often later used for air and escape shafts; this information is included in the directory when known. The tippie for underground mines was generally located near the main shaft or slope. At surface mines, coal was sometimes hauled to a central tippie several miles from the mine pit.

GEOLOGY

Seam(s) mined The name of the coal seam(s) mined is listed, if known. If multiple seams were mined, they are all listed, although the mined-out area for each seam may be shown on separate maps. Figure 2 shows the stratigraphic section of the coal-bearing interval in Illinois, and the vertical relations among the coals.

Depth The depth to the top of the seam in the vicinity of the shaft is listed, if known. The depth is determined from notes made by geologists who visited the mine during its operation or from drill hole data in ISGS files. Depth generally varies little over the extent of a mine; however, reported depths for an individual mine may vary. Depth for surface-mined coals varies, and is usually represented as a range.

Thickness The approximate thickness of the mined seam is shown, if known. Thickness also comes from notes of geologists who visited the mine during its operation or from borehole data in ISGS files. Minimum, maximum, and average thicknesses are given when this information is available.

Mining method The principal mining method used at the mine (figs. 1A-H) is listed. See the mining methods section at the beginning of this directory for a discussion of this parameter.

Geologic problems reported Any known geologic problems, such as faults, water seepage, floor heaving, and unstable roof, encountered in the mine are reported. This information is from notes made by ISGS geologists who visited the mine, or from reports by mine inspectors published by the Illinois Department of Mines and Minerals, or from the source map(s). Geologic problems are not reported for active mines.

PRODUCTION HISTORY

Production history Tons of coal produced from the mine by each mine owner are totaled. When the source map used for the mine outline is not a final mine map, the tonnage produced since the date of the map is identified. For mines that extend into adjacent quadrangles, the tonnage reported includes areas mined in adjacent quadrangles.

SOURCE OF DATA

Source map This section lists information about the map(s) used to compile the mine outline and the locations of tipples and mine openings. In some cases more than one source map was used. For example, a map drawn before the mine closed may provide better information on original areas of the mine than a later map. When more than one map was used, the bibliography section explains what information was taken from each source.

Date The date of the most recent mine survey listed on the source map is reported.

Original scale The original scale of the source map is listed. Many maps are photo-reductions and are no longer at their original scale. The original scale gives some indication of the level of detail of the mine outline and the accuracy of the mine boundary relative to surface features. Generally, the larger the scale, the greater the accuracy and detail of the mine map. Mine outlines taken from source maps at scales smaller than 1:24,000 may be highly generalized and may well be inaccurately located with respect to surface features.

Digitized scale The scale of the digitized map is reported. The scale may be different from that of the original source map. In many cases the digitized map was made from a photo-reduction of the original source map, or the source map was not in a condition suitable for digitizing and the mine boundaries were transferred to another base map.

Map type Source maps are classified into five categories to indicate the probable completeness of the map. See discussion of source maps in the previous section.

Annotated bibliography Sources that provide information about the mine are listed, with the data taken from each source. Some commonly used sources are described below. Full bibliographic references are given for all other sources. Unless otherwise noted, all sources are available for public inspection at the ISGS.

Coal Reports Published since 1881, these reports contain tabular data on mine ownership, production, employment, and accidents. Some volumes include short descriptions made by mine inspectors of physical features and conditions in selected mines.

Directory of Illinois Coal Mines This source is a compilation of basic data about Illinois coal mines, originally gathered by ISGS staff in the early 1950s. Sources used for this directory are undocumented, but they are primarily Illinois Department of Mines and Minerals annual reports, ISGS mine notes, and coal company officials.

ENR Document 85/01, Guither, H. D., J. K. Hines, and R. A. Bauer, 1985 The Economic Effect of Underground Mining Upon Land Used for Illinois Agriculture: Illinois Department of Energy and Natural Resources Document 85/01, 185 p.

Microfilm map The U.S. Bureau of Mines maintains a microfilm archive of mine maps. A microfilm file for Illinois is available for public viewing at the ISGS.

Mine notes ISGS geologists have visited mines or contacted mine officials throughout the state since the early 1900s. Notes made during these visits range from brief descriptions of the mine location to long narratives (including sketches) of mining conditions and geology.

Federal Land Bank of St. Louis, Preliminary Reports on Subsidence Investigations Mining engineers working for the Federal Land Bank of St. Louis mapped areas of subsidence due to coal mining in the early 1930s. These reports often include county maps of mine properties with mined-out areas including shaft locations, as well as subsidence areas.

REFERENCES

Bauer, R. A., B. A. Trent, and P. B. Dumontelle, 1993, Mine Subsidence in Illinois: Facts for the Homeowner Considering Insurance, Illinois State Geological Survey, Environmental Geology Note 144, 16p.

Guither, H. D., J. K. Hines, and R. A. Bauer, 1985, The Economic Effects of Underground Mining Upon Land Used for Illinois Agriculture, Illinois Department of Energy and Natural Resources Document 85/01, 185p.

PART II DIRECTORY OF MINES IN THE PANA QUADRANGLE

MINE SUMMARY SHEETS

A summary sheet on the geology and production history of each mine in the Pana Quadrangle is provided. These summary sheets are arranged numerically by mine index number. Consult Part I for a complete explanation of the data listed in the summary sheet.

Mine Index 221

Springside Coal Company, Springside No. 3 Mine

Type: Underground Total mined-out acreage shown: 724 Production indicates approximately 20 acres were mined after the map date.

SHAFT, SLOPE, DRIFT or TIPPLE LOCATIONS

Type	County	Township-Range	Section	Quarters-Footage
Main shaft *	Christian	11N 1E	15	NW NW SE
Air shaft	Christian	11N 1E	15	NW NW SE

* This mine was connected underground to the Penwell Mine (mine index 371) in 1893, for mutual escapement.

GEOLOGY

Seam(s) Mined	Depth (ft)	Thickness (ft)			Mining Method
		Min	Max	Avg	
Herrin	720	6.0	12.0	7.5	RPP

Geologic Problems Reported: Some gas was present; a gas explosion killed the company mine examiner in 1921. The immediate roof was 6 inches to 16 feet of black shale that had many slips. These slips made the roof unstable; it came down readily and required heavy timbering. Top coal may have been left to support the roof until the room was ready for abandonment, as evidenced by a fall of top coal causing a fatality in 1917. Above the black shale was a dark gray shale. A limestone cap rock was above the shale. Pyrite in lenses and bands was present throughout the coal, both laterally and vertically.

PRODUCTION HISTORY

Company	Mine Name	Years	Production (tons)
Springside Coal Mining Company **	Springside	1889-1903	1,405,850
Manufacturers Fuel Company	Springside	1903-1905 ***	110,503
Smith-Lohr Coal Company	Springside	1905-1922	2,361,459
Springside Coal Company	Springside No. 3	1922-1923	113,223
Springside Coal Company	Springside No. 3	1923-1924	106,760 †
			4,097,795

** Weaver Coal & Coke Company operated this mine in 1903.

*** Idle 1905

† Production after map date

Last reported production: March 1924

SOURCES OF DATA

Source Map	Date	Original Scale	Digitized Scale	Map Type
Company, R4103.C4 i5.1-1	5-1923	1:2400	1:2400	Not final

Annotated Bibliography (data source, brief description of information)

Coal Reports - Production, ownership, years of operation, geologic problems.

Directory of Illinois Coal Mines (Christian County) - Mine names, mine index, ownership, years of operation.

Mine notes (Christian County) - Mine type, shaft location, seam, depth, thickness, geologic problems.

Company map, ISGS map library R4103.C4 i5.1-1 - Shaft locations, mine outline, mining method.

Mine Index 222
Pana Coal Company, Pana No. 2 Mine

Type: Underground Total mined-out acreage shown: 453

SHAFT, SLOPE, DRIFT or TIPPLE LOCATIONS

Type	County	Township-Range	Section	Quarters-Footage
Main shaft *	Christian	11N 1E	15	SW NW NW

* This mine was connected underground to the Pana No. 1 Mine (mine index 729). The source map also shows the location of booster fans in strategic locations in the mine, which allowed them to operate without the construction of air shafts separate from the main shaft.

GEOLOGY

Seam(s) Mined	Depth (ft)	Thickness (ft)			Mining Method
		Min	Max	Avg	
Herrin	714-732	6.5	8.0	7.5	MRP

Geologic Problems Reported: According to Netzeband (August 1921) in the Coal Section mine notes, "Lateral pressure is very great in this mine and posts set with a pitch of several degrees are soon pushed straight and eventually pitch in the opposite direction. The vertical pressure causes the coal to rash (chip off the ribs) and requires lagging and filling behind the lagging." The shale roof required heavy timbering, so when the shale was thin, it was shot down with the coal to leave a limestone roof. This shale varied from a well bedded (western part of mine) or massive (eastern part of mine) black shale to a dark gray massive shale. The shale varied in thickness from a feather edge to 8 feet. A brown limestone 1 to 2 feet thick was present in the eastern side of the mine. Slips were present in the shale roof and the upper part of the coal. The seam contained the usual blue band that ranged from 1/4 inch to 3/4 inches. A few slips were observed in the eastern part of the mine, with no discernible displacement. Pyrite lenses and calcite or gypsum fracture facings were present in the seam, throughout the coal both laterally and vertically. The underclay in the western part of the mine was soft and heaved when moistened. The main haulage route in that part of the mine had to be retimbered twice because of the heaving, and had already heaved another 2 feet at the time of the visit. The eastern part of the mine had a firmer clay and no trouble with heaving.

PRODUCTION HISTORY

Company	Mine Name	Years	Production (tons)
Pana Coal Company	Pana No. 2, North	1887-1902	250,000 **
Newbent Coal Company	Pana No. 2, North	1902-1905	257,965
Pana Coal Company	Pana No. 2	1905-1928	2,598,241 ***
			3,106,206

** Production was reported under Pana No. 1 Mine (mine index 729) all years except 1894.

*** Idle 1915-1917

Last reported production: March 1928

SOURCES OF DATA

Source Map	Date	Original Scale	Digitized Scale	Map Type
Microfilm, document 351385	2-1948	1:2400	1:5131	Final

Annotated Bibliography (data source, brief description of information)

Coal Reports - Production, ownership, years of operation.
 Directory of Illinois Coal Mines (Christian County) - Mine names, mine index, ownership, years of operation.
 Mine notes (Christian County) - Mine type, seam, depth, thickness, geologic problems.
 Microfilm map, document 351385, reel 03135, frames 439-442 - Shaft location, mine outline, mining method.

Mine Index 371
Oldroyd Coal Company, Penwell Mine

Type: Underground Total mined-out acreage shown: 1,902

SHAFT, SLOPE, DRIFT or TIPPLE LOCATIONS

Type	County	Township-Range	Section	Quarters-Footage
Main shaft *	Christian	11N 1E	21	NW SE NE

* The mine was connected underground to Springside Mine (mine index 221) for escapement. This connection was completed in 1893, and was on the east side of the mine. After a fire in 1907, the west side of the mine was connected underground to the Pana No. 1 Mine (mine index 729) to ensure a safe escapement from either side of the mine. The source map also shows the location of booster fans in strategic locations in the mine, which allowed them to operate without the construction of air shafts separate from the main shaft.

GEOLOGY

Seam(s) Mined	Depth (ft)	Thickness (ft)			Mining Method
		Min	Max	Avg	
Herrin	724-732	6.0	10.0	7.5	RPP, some HER

Geologic Problems Reported: Many slips were present in the roof, making unstable roof. Gas was present at the face and in the old workings.

PRODUCTION HISTORY

Company	Mine Name	Years	Production (tons)
Penwell Coal Company	Penwell	1888-1941	8,684,300
Victory Coal Mining Company	Penwell	1942-1944	350,573
Oldroyd Coal Company	Penwell	1944-1945	<u>102,182</u>
			9,137,055

Last reported production: November 1945

SOURCES OF DATA

Source Map	Date	Original Scale	Digitized Scale	Map Type
Microfilm, document 351396	7-1947	1:2400	1:5297	Final

Annotated Bibliography (data source, brief description of information)

Coal Reports - Production, ownership, years of operation, geologic problems.
 Directory of Illinois Coal Mines (Christian County) - Mine names, mine index, ownership, years of operation.
 ENR Document 85/01 - Mining method.
 Mine notes (Christian County) - Mine type, seam, depth, thickness, geologic problems.
 Microfilm map, document 351396, reel 03135, frames 482-484 - Shaft location, mine outline, mining method.

Mine Index 679
Peabody Coal Company, Peabody No. 17 Mine

Type: Underground Total mined-out acreage shown: 3,311

SHAFT, SLOPE, DRIFT or TIPPLE LOCATIONS

Type	County	Township-Range	Section	Quarters-Footage
Main shaft	Christian	11N 1E	28	SE NE SW
Air shaft	Christian	11N 1E	28	NE SE SW
Shaft *	Christian	10N 1E	4	SW NW SW

* This is a probable shaft location. The source map appears to indicate a shaft, and it is unlikely that a mine of this size would have only a single shaft and air shaft.

GEOLOGY

Seam(s) Mined	Depth (ft)	Thickness (ft)			Mining Method
		Min	Max	Avg	
Herrin	700-713			8.0	RPP

Geologic Problems Reported: The roof was 3 to 15 feet of shale that came down readily. One roof fall was noted with about 8 feet of gray shale above the coal, and the rubble included occasional nodules over 1 foot across, and slickensided surfaces of rubble. The falls proceeded upward to the limestone above the shale. Various methods of roof support were practiced, including roof bolting, timbers, combinations of roof bolting with timbers, and top coal alone or with roof bolts or timbers. About 1.5 feet of top coal was left to support the roof. Pyrite was present in the seam in bands, lenses and nodules. The seam also had some shale bands. The product was used, unwashed, to fuel a nearby power plant, and excess slagging of the boilers indicate that impurities in the seam were higher than desired.

PRODUCTION HISTORY

Company	Mine Name	Years	Production (tons)
Peabody Coal Company	Peabody No. 17	1949-1957	15,451,943
			15,451,943

Last reported production: December 1957

SOURCES OF DATA

Source Map	Date	Original Scale	Digitized Scale	Map Type
Company, 4103.C4 i5.1-13	1-1-1958	1:12000	1:12000	Final

Annotated Bibliography (data source, brief description of information)

Coal Reports - Production, ownership, years of operation, depth, thickness.
 Directory of Illinois Coal Mines (Christian County) - Mine names, mine index, ownership, years of operation.
 Mine notes (Christian County) - Mine type, shaft location, seam, geologic problems.
 Company map, ISGS map library 4103.C4 i5.1-13 - Shaft locations, mine outline, mining method.

Mine Index 729**Old Mine Coal Company, Pana No. 1 Mine**

Type: Underground Total mined-out acreage shown: 1,036 Production indicates approximate 3 acres were mined after the map date.

SHAFT, SLOPE, DRIFT or TIPPLE LOCATIONS

Type	County	Township-Range	Section	Quarters-Footage
Main shaft (7x18)	Christian	11N 1E	16	SE SW SE
Air shaft *	Christian	11N 1E	16	SE SE SW

* Pana No. 1 Mine was connected underground to the Penwell Mine (mine index 371) by 1908, in addition to their escape shaft that was completed in 1888.

GEOLOGY

Seam(s) Mined	Depth (ft)	Thickness (ft)			Mining Method
		Min	Max	Avg	
Herrin	704-730			7.5	MRP

Geologic Problems Reported: Limestone roof covered much of the mine, but where the roof was shale, such as near the shaft bottom, the shale would weather and fall.

PRODUCTION HISTORY

Company	Mine Name	Years	Production (tons)
Pana Coal & Mining Company	Pana No. 1	1884-1941 **	7,197,197
Pana Mines Corporation	Pana No. 1	1942-1945	209,304
Old Mine Coal Company	Pana No. 1	1946-1948	124,316
Old Mine Coal Company	Pana No. 1	1948-1948	22,927 ***
			7,553,744

** Idle 1915, 1916, 1941

*** Production after map date

Last reported production: June 1948

SOURCES OF DATA

Source Map	Date	Original Scale	Digitized Scale	Map Type
Microfilm, document 351385	2-1948	1:2400	1:5131	Not final

Annotated Bibliography (data source, brief description of information)

Coal Reports - Production, ownership, years of operation, depth.

Directory of Illinois Coal Mines (Christian County) - Mine names, mine index, ownership, years of operation.

Mine notes (Christian County) - Mine type, seam, thickness, geologic problems.

Microfilm map, document 351385, reel 03135, frames 439-442 - Shaft locations, mine outline, mining method.

INDEX OF MINES IN THE PANA QUADRANGLE

Manufacturers Fuel Company	9
Newbent Coal Company	10
North Mine	10
Old Mine Coal Company	13
Oldroyd Coal Company	11
Pana Coal & Mining Company, No. 1 Mine	13
Pana Coal Company, No. 2 Mine	10
Pana Mines Corporation	13
Peabody Coal Company	
No. 17 Mine	12
Penwell Coal Company	11
Smith-Lohr Coal Company	9
Springside Coal Mining Company	9
Victory Coal Mining Company	11
Weaver Coal & Coke Company	9

Funding for this project was supplied by the Illinois Mine Subsidence Insurance Fund.